

Western 

POLICY: LEAD-BASED PAINT ABATEMENT AND WORK PROCEDURES	NUMBER: WP-47
	Page 1 of 2

WORKER PROTECTION:

1. All individuals entering the area must be trained in lead abatement procedures.
2. Workers must at all times wear approved half-face or full-face respirators with P100 cartridges. If half-face respirators are being used the workers must also wear dust proof goggles at all times.
3. Disposable non-breathable coveralls with head and foot protection must be worn at all times.
4. Disposable gloves suitable for the intended work must be worn at all times.

WORK PROCEDURES:

1. All loose and peeling paint must first be removed using manual scrapers. All debris generated during this process must be collected using a HEPA vacuum and properly disposed of as lead waste.
2. Frequently clean up any dust and waste contaminated with paint debris. Clean up must be performed with a HEPA vacuum or by wet wiping. All waste contaminated with lead paint debris must be disposed of as lead waste.
3. Disposable coveralls and foot wear shall be removed prior to leaving the work area and must be disposed of as lead waste as well.
4. Individuals leaving the enclosure shall immediately wash their hands and face thoroughly at the nearest washroom.

CLEAN-UP:

1. All lead-based paint waste will be collected within the enclosure and double bagged in 6 mil polyethylene bags and labelled as lead-contaminated waste on the outside of the bag.
2. All tools and equipment inside the enclosure shall be HEPA vacuumed before removal from enclosure.
3. If the f(ed)3Tm0 goP55.5b47(r)-3(e)13(m)7(o2hr9(W*no64 223.37 Tm0ET655b47(r)-51.04 T6-51